

Coastal Protection and Restoration Authority of Louisiana

Office of Coastal Protection and Restoration

2008/2009 Annual Inspection Report

for

FOUR MILE CANAL TERRACING AND SEDITMENT TRAPPING PROJECT (TV-18)

State Project Number TV-18 Priority Project List 9

October 9, 2008 Vermilion Parish

Prepared by:

Stan Aucoin, Engineering Tech. CPRA/ Office of Coastal Protection and Restoration Lafayette Field Office 635 Cajundome Blvd. Lafayette, LA 70596

Table Of Contents

I. Introduction						
II. Inspection Purpose and Procedures						
III. Project Description and History2						
IV. Summary of Past Operation and Maintenance Projects						
V. Inspecti	on Results	7				
VI Conclus	sions and Recommendations	3				
	Appendices					
Appendix A	A Project Features Map					
Appendix B	B Photographs					
Appendix C	Three Year Budget Projections					
Appendix I	Pield Inspection Notes					
Appendix E	E Map showing areas to be monitored					

I. Introduction

The Four Mile Canal Terracing and Sediment Trapping (TV-18) project is located approximately 4 miles (6.44 km) south of Intracoastal City in Vermilion Parish, Louisiana, and includes Little White Lake and the portion of Little Vermilion Bay immediately west of Four-Mile Canal also known as the Vermilion River Cutoff (Appendix A). The total project area comprises approximately 2,269 acres.

The Four Mile Canal Terracing and Sediment Trapping Project was authorized by Section 303(a) of Title III Public Law 101-646, the Coastal Wetlands Planning Protection and Restoration Act (CWPPRA) enacted on November 29, 1990 as amended and approved on the ninth Priority Project List. The Four Mile Canal Project has a twenty year (20 year) economic life, which began in May 2004.

II. Inspection Purpose and Procedures

The purpose of the annual inspection of the Four Mile Canal Terracing and Sediment Trapping Project (TV-18) is to evaluate the constructed project features to identify any deficiencies and prepare a report detailing the condition of project features and recommended corrective actions needed. Should it be determined that corrective actions are needed, OCPR shall provide, in the report, a detailed cost estimate for engineering, design, supervision, inspection, and construction contingencies, and an assessment of the urgency of such repairs (O&M Plan, 2005). The annual inspection report also contains a summary of maintenance projects which were completed since completion of constructed project features and an estimated projected budget for the upcoming three (3) years for operation, maintenance and rehabilitation. The three (3) year projected operation and maintenance budget is shown in Appendix C. A summary of past operation and maintenance projects completed since completion of the Four Mile Canal Project are outlined in Section IV.

In 2003, the CWPPRA Task Force determined, due to the fact that OCPR was responsible for the operation and maintenance phase of the vast majority of CWPPRA projects, that OCPR would be the responsible party for all Post Storm/Hurricane Assessments. After Hurricane Ike, every project appeared to have been impacted by the storms; therefore, OCPR determined that all projects should be assessed for damages (Broussard, 2006). With concurrence from the federal sponsor, OCPR has decided to use the information obtained during this post hurricane assessment in this Annual Maintenance Inspection.

An inspection of the Four Mile Canal Terracing and Sediment Trapping Project (TV-18) was held on October 9, 2008 under clear skies and hot temperatures. In attendance were Stan Aucoin and Mel Guidry from (OCPR) and John Foret of NOAA Fisheries. Parties met at the Lafayette Field Office of CED and traveled to Intracoastal City in Vermilion Parish, LA. The annual inspection began at the site of the terraces constructed in Little White Lake.

The field inspection included a visual inspection of the project site. Staff gauge readings were used, when available, to determine approximate elevations of water and earthen terraces.

Photographs were taken at each project feature (see Appendix B) and Field Inspection notes were completed in the field to record measurements and deficiencies (see Appendix D).

III. Project Description and History

The Flood Control Act of 18 August 1941 enacted by the United States Congress provided for improvements in the Vermilion River. Vermilion River Cutoff, an 8 ft by 80 ft (2.44 m by 24.38 m) channel from the -8 foot contour in the Vermilion Bay to the Gulf Intracoastal Waterway (GIWW) was constructed for improving navigation from Lafayette, LA to the -8 foot (-2.44 m) contour in Vermilion Bay and to improve flood control from Port Barre, LA to the Vermilion Bay via Bayou Teche, Bayou Fusilier and Vermilion River. The materials excavated to build the canal were deposited in spoil banks along the canal. This prevented the river waters from nourishing the adjacent marsh (USACE 1993; HNTB 2002). The main cause of marsh loss in this area is believed to be shoreline erosion. From the 1978 Louisiana Department of Transportation and Development (LDOTD) inventory and assessment of shoreline erosion in coastal Louisiana, the Abbeville 15 minute Quadrangle, which depicts Vermilion Bay near Onion Bayou, documents an erosion rate of 1.6 ft/yr (0.5 m/yr) and just adjacent to that in the Cheniere Au Tigre & Abbeville 15 minute Quadrangle, which is Vermilion Bay (Mud Point to Lake Cleodis) has an erosion rate of 2.6 ft/yr [0.8 m/yr] (Adams et al. 1978). Shoreline change, specifically in the project area, calculated by USGS was 2.86 ft/yr (0.87 m/yr) and island area change was 0.64 acres/yr (0.26 ha/yr [2003]). A combination of wave and wake erosion continues to deteriorate this area, which is relatively unprotected and affected by storm events emerging from Vermilion Bay. This erosion prevents sub-aerial marsh development from sediments introduced to the area by the GIWW through the Vermilion River and Four-Mile Canal (LDNR 1999).

The construction of terraces in Little White Lake and Vermilion Bay will buffer existing marsh against shoreline erosion by reducing wave and wake energy. Marsh will immediately be created by planting *S. alterniflora* along the crowns and slopes of the constructed terraces. Additionally, new marsh will be created as freshwater and suspended sediments introduced from Four Mile Canal and the Vermilion River are dispersed through the project area via conveyance channels, and trapped in the shallow open water adjacent to the terraces. In doing so, terraces may indirectly reduce water-column turbidity within the project area. This, in conjunction with decreased wave and wake energy, will create habitat suitable for the colonization by submerged aquatic vegetation (SAV). Fisheries habitat may be enhanced by the marsh edge created by the terraces and the propagation of SAV. Conveyance channels may also promote the exchange of organisms and organic material within and through the project area (2005 DNR OM&M Report).

The principal project features include:

1. 26,300 linear feet of earthen terraces constructed in Little White Lake

- 2. 40,300 linear feet of earthen terraces constructed in Little Vermilion Bay
- 3. Smooth Cordgrass plantings on all terraces

IV. Summary of Past Operation and Maintenance Projects

General Maintenance: Below is a summary of completed maintenance projects and operation tasks performed since May 2004, the construction completion date of the Four Mile Canal Terracing and Sediment Trapping Project.

None as yet required.

Structure Operations:

There are no active operations associated with this project.

V. Inspection Results

Site 1—Earthen terraces

Little White Lake Terraces, for the most part, survived the storm intact. Vegetation is recovering. The 4th row of terraces has only three terraces remaining. The third row is in relatively good condition. The first and second rows are in excellent shape. Sediment has been deposited in the channel right at the entrance to the terrace field. Whether this is a result of the hurricane is unknown. Four Mile Canal northern most terraces continue to erode as well as the western most terraces. Vegetation is recovering. Channels between the terraces also are silting in. No maintenance needed at this time. (Photos: Appendix B, Photo 1-2)

Site 2—Vegetation plantings

Vegetation, while stressed from Hurricane Ike, appears strong and has spread throughout the terraces. A staff gauge needs to be installed in the vicinity of the Little White Lake terraces. No other maintenance needed at this time.


VI. Conclusions and Recommendations

The Four Mile Canal Terracing and Sediment Trapping Project is in very good condition and functioning as intended. Staff gauges should be installed at convenient locations when other survey work in the area is required. Projected maintenance for 2009/2010:

• Install staff gauge

Appendix A

Project Features Map

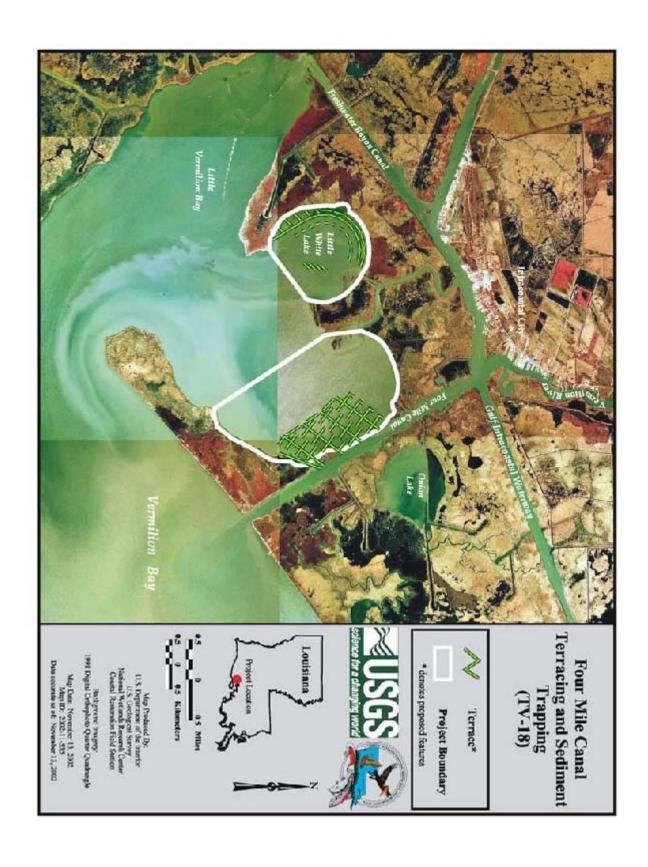

Appendix B

Photographs



Photo No. 1, Little White Lake terraces



Photo No. 2, Four Mile Canal terraces

Appendix C

Three Year Budget Projection

FOUR MILE CANAL/ TV18 / PPL 9 Three-Year Operations & Maintenance Budgets 07/01/2009 - 06/30/2012

Project Manager	O & M Manager	Federal Sponsor	Prepared By						
Pat Landry	Stan Aucoin	NMFS	Stan Aucoin						
	2009/2010	2010/2011	2011/2012						
Maintenance Inspection	\$ 5,737.00	\$ 5,909.00	\$ 6,086.00						
Structure Operation									
Administration		\$ -	\$ -						
Maintenance/Rehabilitation									
09/10 Description: Add staff gage.									
E&D	\$7,500.00								
Construction									
Construction Oversight									
Sub Total - Maint. And Rehab.									
	,								
10/11 Description									
E&D		\$ -							
Construction		\$ -							
Construction Oversight		\$ -							
	Sub Total - Maint. And Rehab.	\$ -	:						
11/12 Description:									
E&D			\$ -						
Construction			\$ -						
Construction Oversight			\$ -						
		Sub Total - Maint. And Rehab.	\$ -						
	2009/2010	2010/2011	2011/2012						
Total O&M Budgets	\$ 13,237.00	\$ 5,909.00	\$ 6,086.00						
3.33,0.0			,						
	_								
O &M Budget (3 yr Tot	\$ 25,232.00 \$ 45,442.00								
Unexpended O & M Bu Remaining O & M Bud	\$ 15,142.00 \$ (10,090.00)								
Nemaining U & W Bud	<u>Φ (10'090'00)</u>								

Appendix D

Field Inspection Form

MAINTENANCE INSPECTION REPORT CHECK SHEET

Project No. / Name: TV-18 Four Mile Canal Date of Inspection: October 9, 2008 Time:

Structure No. N/A Inspector(s): Stan Aucoin, Mel Guidry (OCPR)

John Foret (NMFS)
Structure Description: Terracing and Sediment Trapping Water Level NAVD

Type of Inspection: Annual Weater Conditions: Sunny and warm

Item	Condition	Pysical Damage	Corrosion	Photo #	Observations and Remarks
Steel Bulkhead	N/A				
/ Caps					
Steel Grating	N/A				
Stop Logs	N/A				
. •					
Hardware	N/A				
Timber Piles	N/A				
Timber Wales	N/A				
Galv. Pile Caps	N/A				
Gaiv. Pile Caps	IVA				
Vegetation	Good				
Signage	N/A				
/Supports	IVA				
Rip Rap (fill)	N/A				
Eathern					
Embankment				1 & 2	
Terraces	Good				Expected erosion on sacrificial terraces. Significant erosion on terraces adjacent to Vermilion River Cut Off.

What are the conditions of the existing levees? Are there any noticable breaches? Settlement of rock plugs and rock weirs? Position of stoplogs at the time of the inspection? Are there any signs of vandalism?

Appendix E

Locations to be Monitored